



User Instructions for TDB Compression Fittings

TDB Compression Fittings are Fully Certified with I.S EN1254-2

- 1** The tube dimensions to be joined must conform to EN 1057 and be approved by the National Standards Authority of Ireland.



- 2** Select the correct fitting in both size and for the connection required. We strongly recommend a tube cutter to ensure a clean, straight cut. If any other tool is used the cut should be thoroughly deburred and any swarf removed. A visual inspection should be carried out before assembly.



- 3** With the advent and popularity of pex and similar pipe, this needs to be cut with a plastic pipe cutter. An insert must be used to support the wall of the pipe when compressing.



- 4** Slide the nut and ring onto the tube and insert into the fitting as far as the raised pipe stop. The nut must now be hand tightened. Then using open ended spanners of the correct size the nut is tightened to the requisite number of turns. Take extra care, not to over tighten the fitting. Never use a Stillson or similar tool as this can distort the nut.



BRASS PRODUCTS ARE NOT SUITABLE FOR UNDERGROUND USE

Uppercross Enterprises Ltd.

Unit 1c, Broomhill Business Complex, Broomhill Road, Tallaght, Dublin 24.

Telephone +353 1 4000 000 - Fax + 353 1 4000 001 - Email sales@uel.ie

www.uel.ie



Manufacturers Recommendations

- 1 The use of a light oil on the threads of larger sized compression fittings will aid the nut to turn and compress the ring with less force.
- 2 As stated previously on page 1 take extra care not to over tighten the fitting. Never use a stillson or any ill fitting tool to reduce the possibility of introducing stress corrosion into the fitting. There is no benefit only risk in over tightening a fitting.
- 3 The use of jointing compounds is neither necessary nor recommended. However, under certain circumstances or if a weep occurs it can be used on the jointing surfaces but not on the threads.
- 4 On soft coiled copper tubes depending on the manufacturers guidelines an insert may be mandatory.
- 5 When jointing male and female threads be careful not to over tighten and deform the female socket. Flax is not suitable as it is easy to over pack the threads. PTFE or a liquid/paste is recommended.
- 6 It is very important to keep joint clean and free from sand, soil, grit or other contaminants.

Uppercross Enterprises Ltd

Unit 1c, Broomhill Business Complex, Broomhill Rd, Tallaght, Dublin, D24VP80

t: 01 4000 000

f: 01 4000 001

e: sales@uel.ie

w: www.uel.ie